

City of Wichita, Kansas

Americans with Disabilities Act Transition Plan

Naftzger Memorial Park

600 East Douglas

July 2005



Prepared by

DMCG

Disability Management Consulting Group L.L.C.

2801 Jonquil Place
Columbia, MO 65202

In conjunction with

The Great Plains ADA & IT Center and the City of Wichita Disability Advisory Board

City of Wichita – ADA/504 Transition Plan – Naftzger Memorial Park - July 2005

Legend: **Blue** font identifies hyperlinked documents – **Red** font indicates recommended changes to structures or policies

Locations		Structural Inconsistencies	Recommended Corrections/Modifications to Ensure Program Access	Criteria – L=low, M=medium, H=high			Supplemental Technical Information			Finalized Actions		
Location	Identified Issue	ADAAG Specifications	Recommended Correction	Priority (overall)	Public Access	Frequency - PWD	Photo #	Conceptual Costs	Support Information	Finalized Correction	Date to be Corrected	Date Completed (Include initial)
1. Pedestrian Paths	The path of travel, leading to the water's edge, has a very steep running slope and does not provide handrails.	4.8	The slope of the existing ramp is steeper than ADAAG's maximum of 8.33%, measuring over 18%. In addition, ADAAG specifies that accessible routes with running slopes greater than 5% provide handrails on each side. Since this ramp has an extremely running slope (likely too steep for safe use by individuals without disabilities), we recommend modifying the ramp to comply with ADAAG slope specifications, including the existence of handrails on each side of running slopes greater than 5%.	M ®	H	M	1	\$1,500	Ramp Detail			
2. Pedestrian Paths	The running slope on the walking bridge is too steep.	4.8	The slope of the bridge is steeper than ADAAG's maximum of 8.33%, measuring over 12%. Modify this bridge surface to comply with ADAAG ramp specifications or otherwise ensure that individuals with disabilities can enjoy a similar experience.	M ®	H	M	2	\$1,500	Ramp Detail			
3. Drinking Fountain	The drinking fountains are not accessible to an individual who uses a wheelchair.	4.15 4.1.3(10)	According to ADAAG, the number of all facilities and elements, which are required to be accessible, are delineated in ADAAG section 4.1 . However, 4.1 only addresses drinking fountains in reference to floors of a building or facility. The program access provisions of Title II require all programs and services to be accessible and usable. Drinking fountains are a service provided by the City and must be made accessible. The number of drinking fountains that are required to be accessible in a park setting is debatable, but we consider that at least one at this particular park should be fully accessible to individuals who use wheelchairs. Modify the existing drinking fountain to comply with ADAAG specifications for individuals who use wheelchairs, including spout height.	L	M	M	4	\$300	Building Block 7 – Drinking Fountains Sample hi-lo fountain in park setting			

Naftzger Memorial Park - Conceptual Cost Projections

Total	\$3,300
Year One (Very High)	\$0
Year Three (High)	\$0
Year Five (Medium)	\$3,000
Year Ten (Low)	\$300